



Bulletin #: IMCFSM-
 Rev: A
 Pages: 1
 Author: Richard Waters
 Date:
 Affected Models: Chief 2002/03

FSM Bulletin

(Field Service Managers only)

Speedometer Compatibility


Speedometer Compatibility

The 2003 Model Year (MY) speedometer (P/N 56-053 & 56-054) & mounting bracket (P/N 56-050) are different from the 2002MY speedometer.

The 2003MY mounting studs on the rear of the speedometer are now shorter, resulting in a reduced height of the mounting bracket (P/N 56-050).

The 2003MY mounting bracket is compatible with both the 2002MY & 2003MY speedometers, but the 2002MY mounting bracket is ONLY compatible with the 2002MY speedometer.

DO NOT over torque the nuts. Over torquing deforms the plastic case and will allow water to leak into the speedometer. Torque the nuts to 5-1/2 **inch-pounds** +/- 1/2.

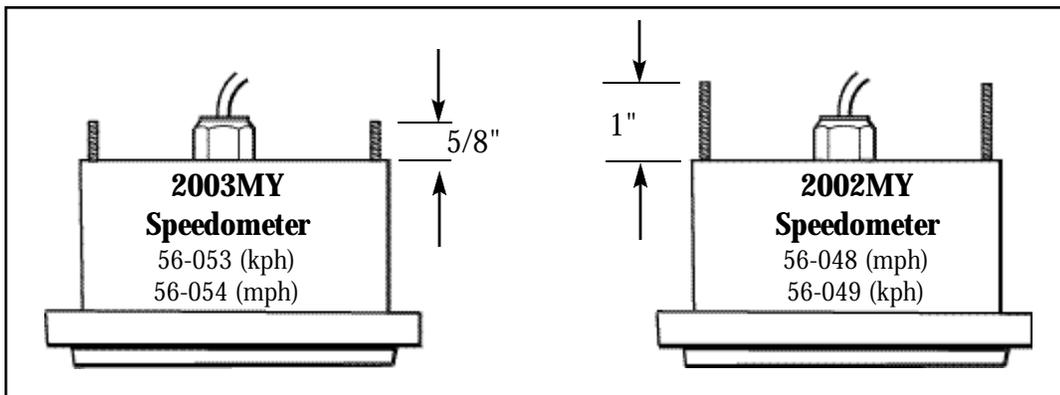

Compatibility Chart

	02 Speedometer	03 Speedometer
02 Bracket	Yes	No
03 Bracket	Yes	Yes